



Preliminary Information

PIT5855 Heated and Ventilated Seats Inoperative

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	XT6	2021	All	All	All	All

Involved Region or Country	North America
Condition	Both front heated and ventilated seats inoperative. On further inspection it may be found that fuse F19DA is open. If the fuse is replaced it may be okay for a while or it may immediately go open again.
Cause	Circuit 639 shorted to ground on the passenger seat back frame.

Correction:

Remove the front passenger seat back cover.

Inspect the harness that goes to the seat back blower for chaffing on the seat back frame in the area shown below.



The harness may need to be moved to see the area that is damaged.



Repair the damaged circuits following the correct procedure in SI for wire and connector repair.

Version History

Version	1
Modified	09/23/2021 - Created on.



© 2021 General Motors. All Rights Reserved.